

11 October 2023

21027 Sunflower County Consolidated SD Phase I / Report Number 007

	Contract	UpChurch Services, LLC
201 Park Court, Suite B	Date / Time	10 October 2023 / 11:30 AM
Ridgeland, MS 39157	Weather / Temp	Partly cloudy / 68 ° F
P 601.790.9432	Est % Complete	56 %
F 888.281.0547	Sched Conformance	[(+,-) 00] days
	Work in Progress	None
One Jackson Place, Suite 250 188 East Capitol Street Jackson, MS 39201-2100 P 601.352.5411 F 601.352.5362	Present at Site Observations	In session school; no construction workers present I walked the site at Merrit middle as requested by contractor to review select toilet rooms for substantial. These rooms however are not ready for substantial completion and require more work. Several issues are noted in each space and listed in the attached figure section of this report. Notably issues are as follows:
161 Lameuse Street, Suite 201 Biloxi, MS 39530 P 228.374.1409 F 228.374.1414		<ul> <li>Incorrect cove base is installed in several locations.</li> <li>Installed tile in several areas is done poorly and not acceptable</li> <li>Incorrect grout color is installed in several locations</li> <li>Some plumbing fixtures need to be centered/reinstalled</li> <li>Paint work has not occurred</li> <li>Open plumbing drains exist</li> <li>No partitions are installed</li> </ul>

No partitions are installed

I am unable to review for substantial completion but would encourage the contractor to know that issues I have brought up in the attached figures will be included on any substantial completion document.

Items to Verify

Action Required

Report By:

See attached figures.

none

Paul Purser, AIA Dale | Bailey, an Association

Terry Green, Steven Kovac, Scott Upchurch, Miskia Davis, Lillie Robey, Marvin Hawkins, cc: Gary Bailey, Mark Pipper, Jason Stewart, Russ Blount, Paul Purser, Sabrena Patrick, Tom Schaeffer, Will Grigg, William Knight, Jason Kackley, Al Guynes, Chris Green, Larry Scott, Jennifer Baughn, Barry White



Figure 1 – grout lines should be aligned with horizontal cmu mortar lines

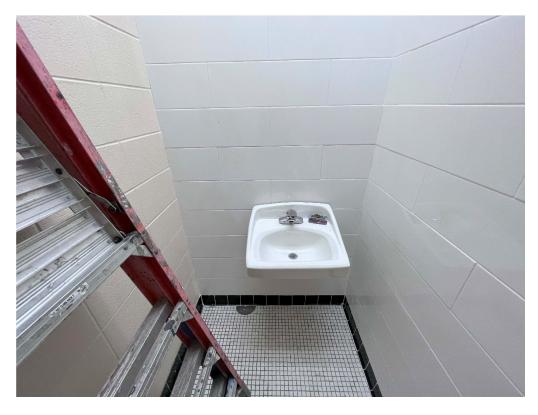


Figure 2 – remove and center fixture in space

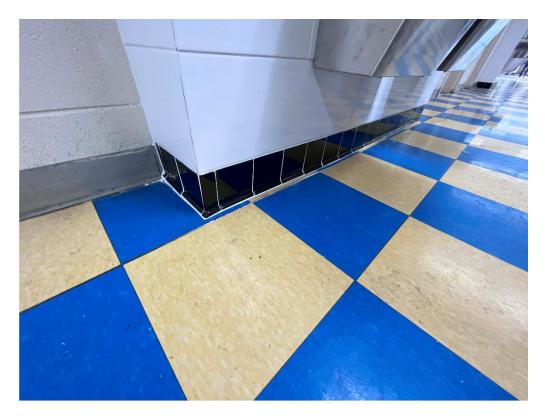


Figure 3 – specified grout is to be midnight black; replace

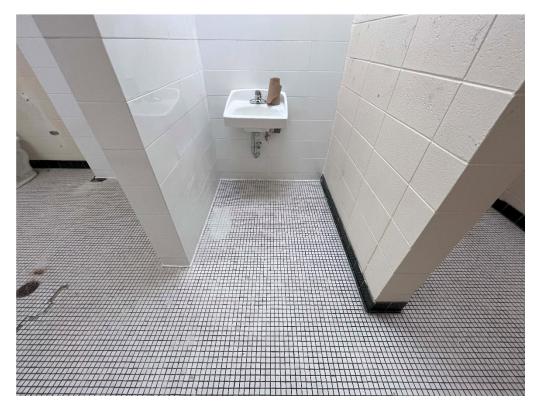


Figure 4 – lavatories should be centered in space; remove and install centered



Figure 5 – Base Cove tile should be black and installed flush with wall tile



Figure 6 – Open sewer pipe should be capped below floor and sealed

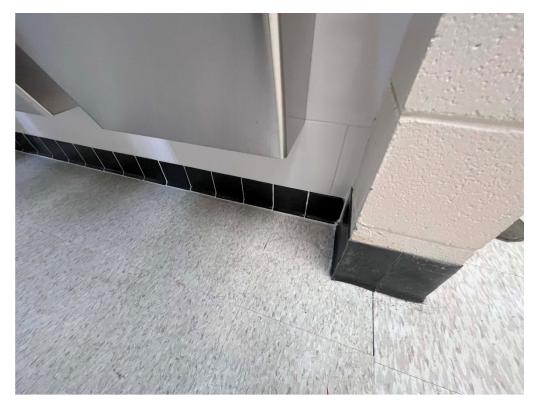


Figure 7 – specified grout for black tile is midnight black



Figure 8 – 1 coat of paint



Figure 9 – Painted 1 coat only



Figure 10 – Tiles throughout are not acceptable. They should be flush



Figure 11 – This tile wall is not acceptable. Tiles should be flush and flat



Figure 12 – Completely Fill gaps so that sealants has no recess