



Revisions	Rev Date

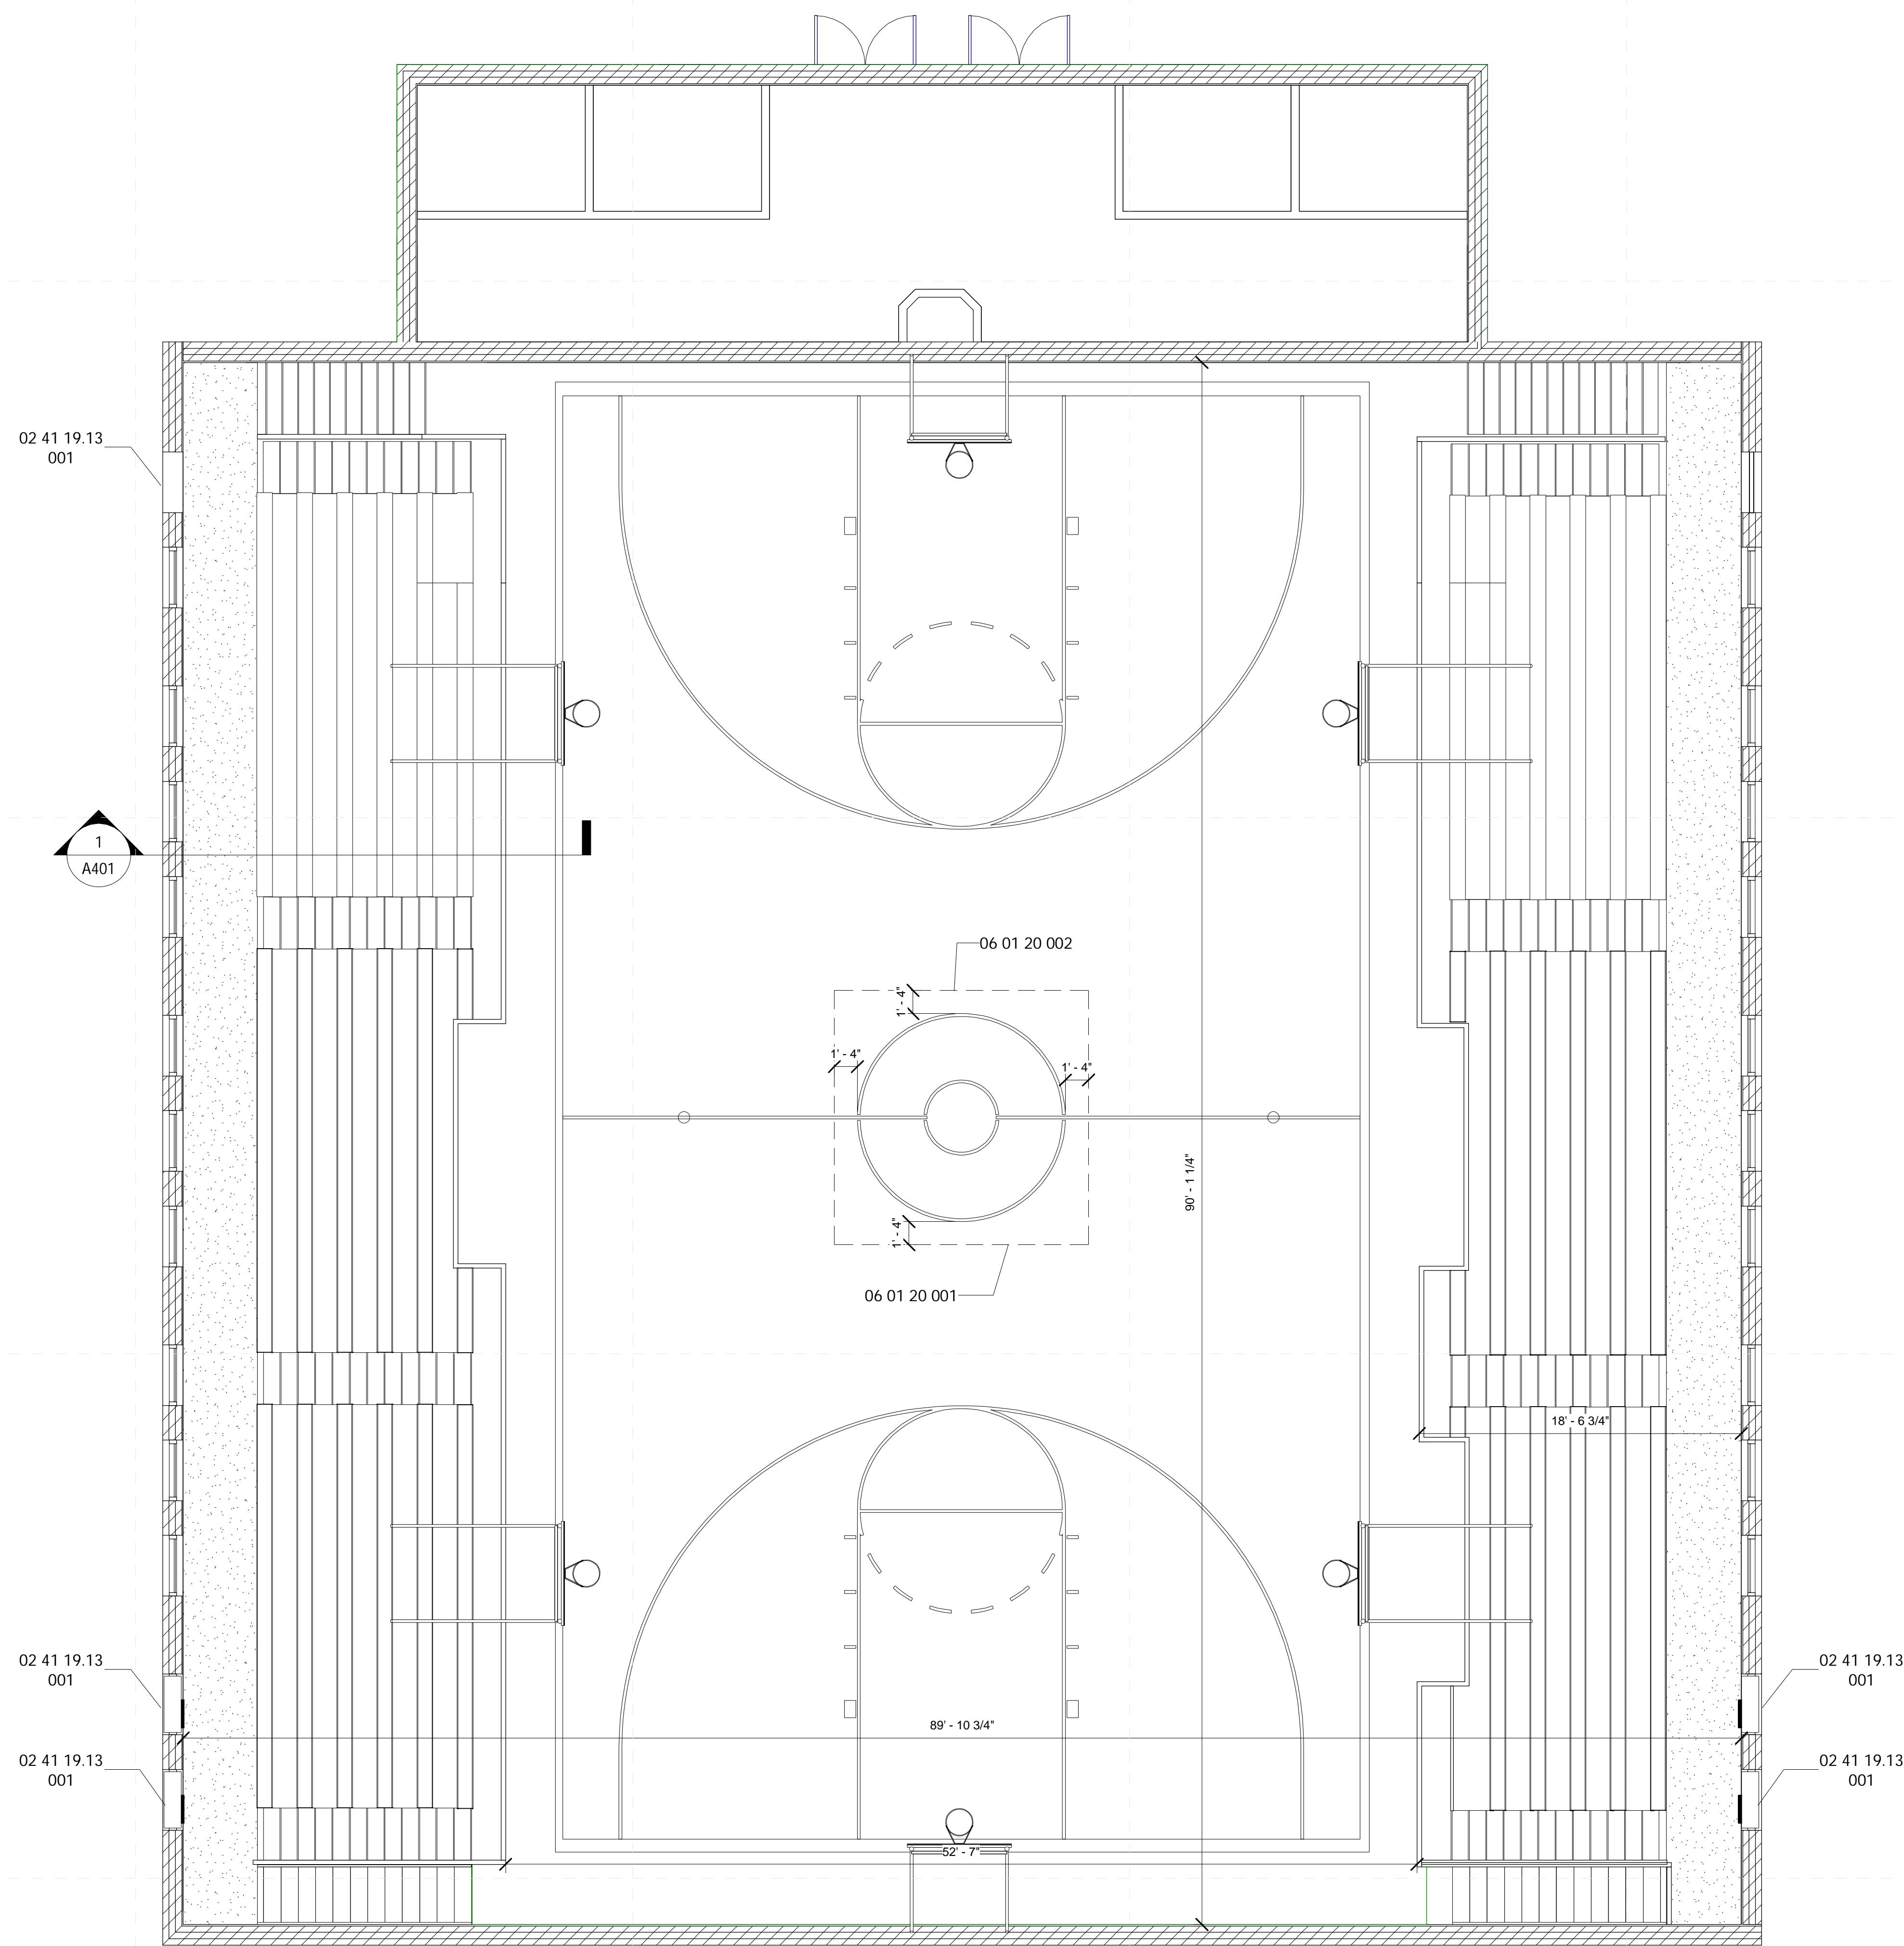

Specific Notes

02 41 19.13 001	Remove Existing Louvers and/or Vent Fans @ Window Openings
06 01 20 001	Cut floor at dotted line: cut floor & subfloor; remove as one unit for relocation to wall per owner's input; support demoed item as needed to keep intact as one unit
06 01 20 002	Patch subfloor as needed so that existing finish wood floor and patched subfloor are flush for new floor installation

**Not For
Construction**

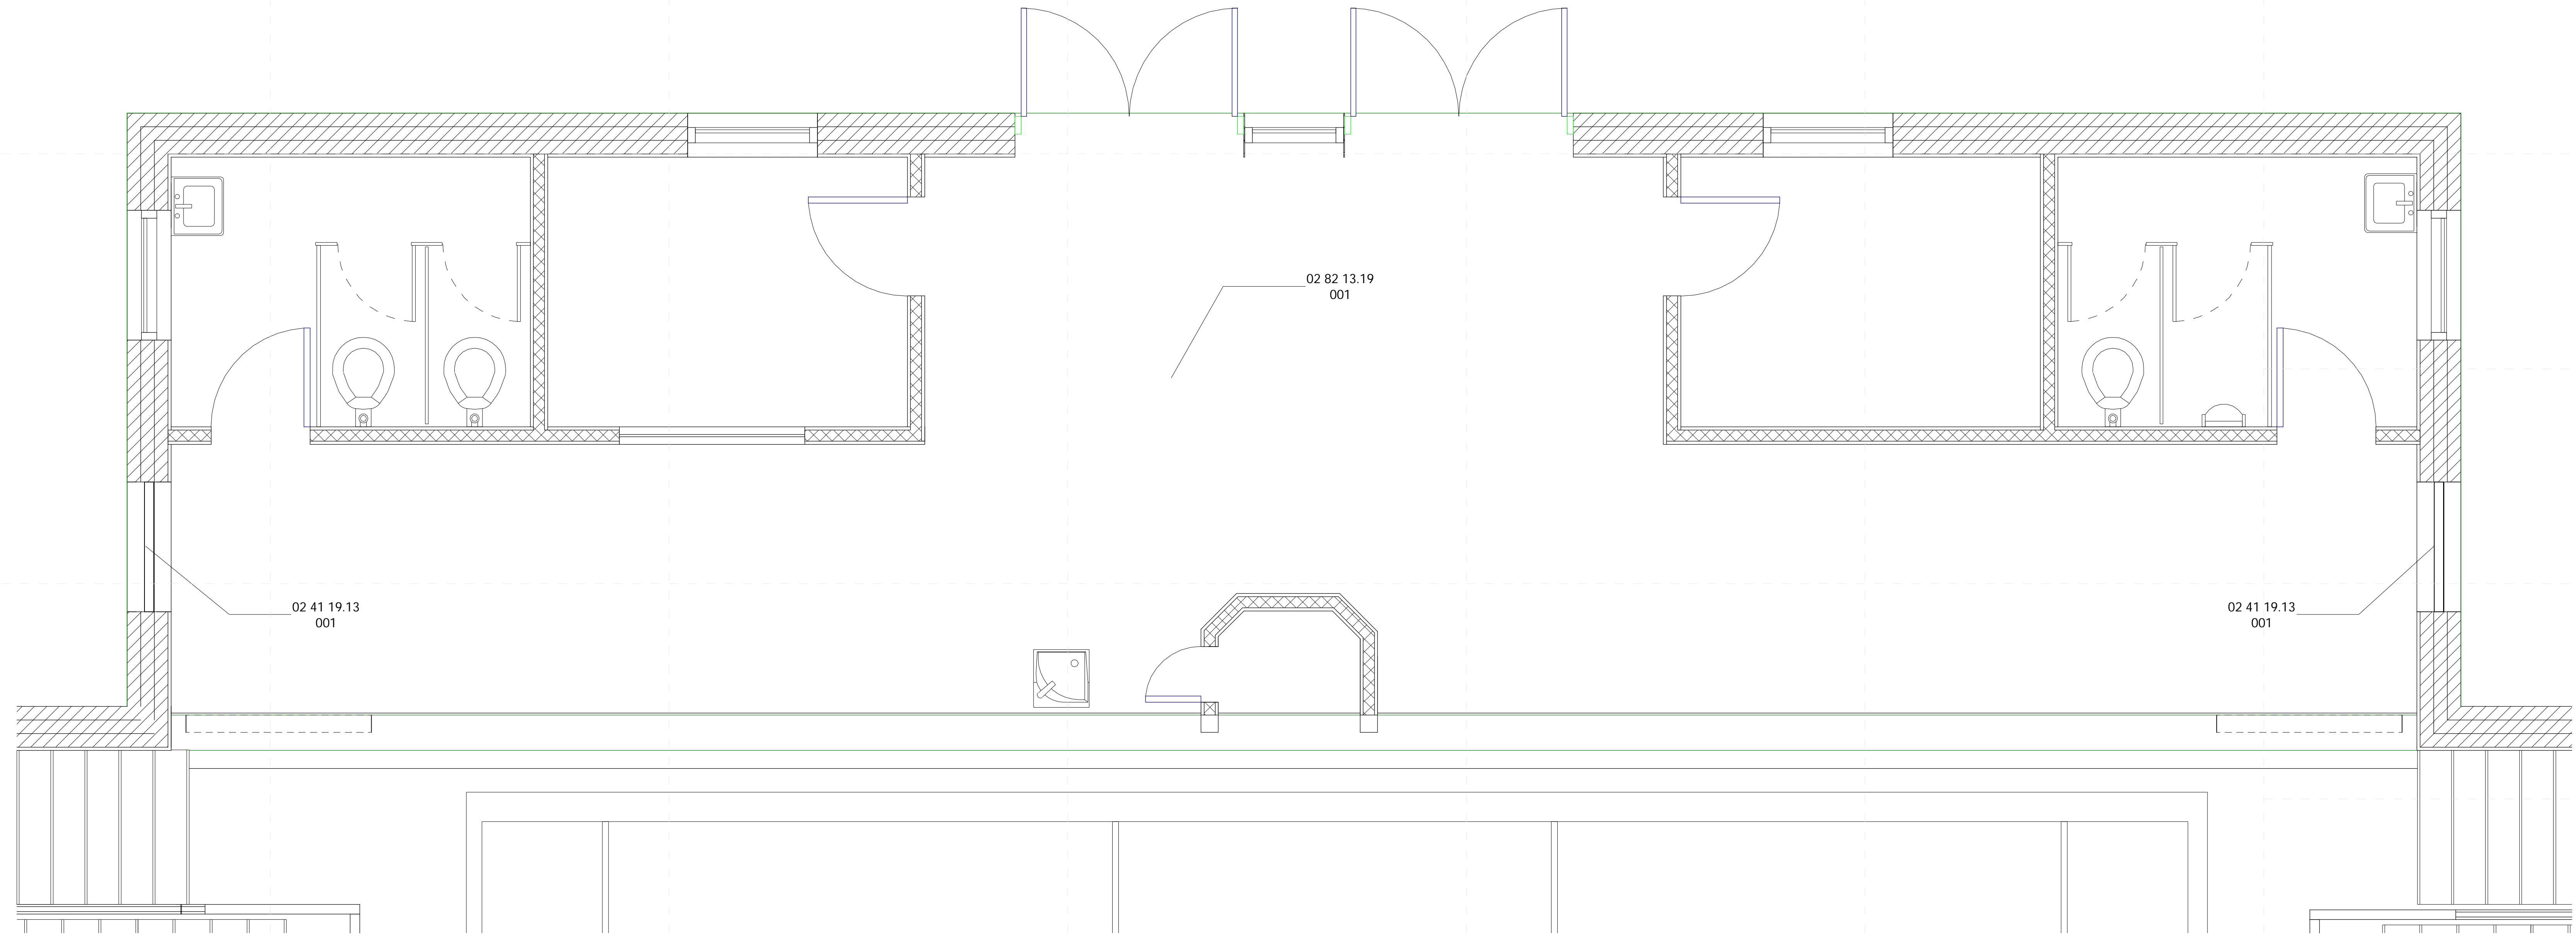

1 PCS Junior High School 2nd LVL - Concessions - Existing
1/2" = 1'-0"

Specific Notes

02 41 19.13 001	Remove Existing Louvers and/or Vent Fans @ Window Openings
02 82 13.19 001	Remove all asbestos containing flooring to substrate

Revisions	Rev Date

Not For
Construction

PCS Junior High School Renovations
132 N Main St
Pontotoc, MS 38863

Schematic
Design

Project No 21064


Date

Revisions Rev Date

Revisions	Rev Date

A042

RCP - Existing

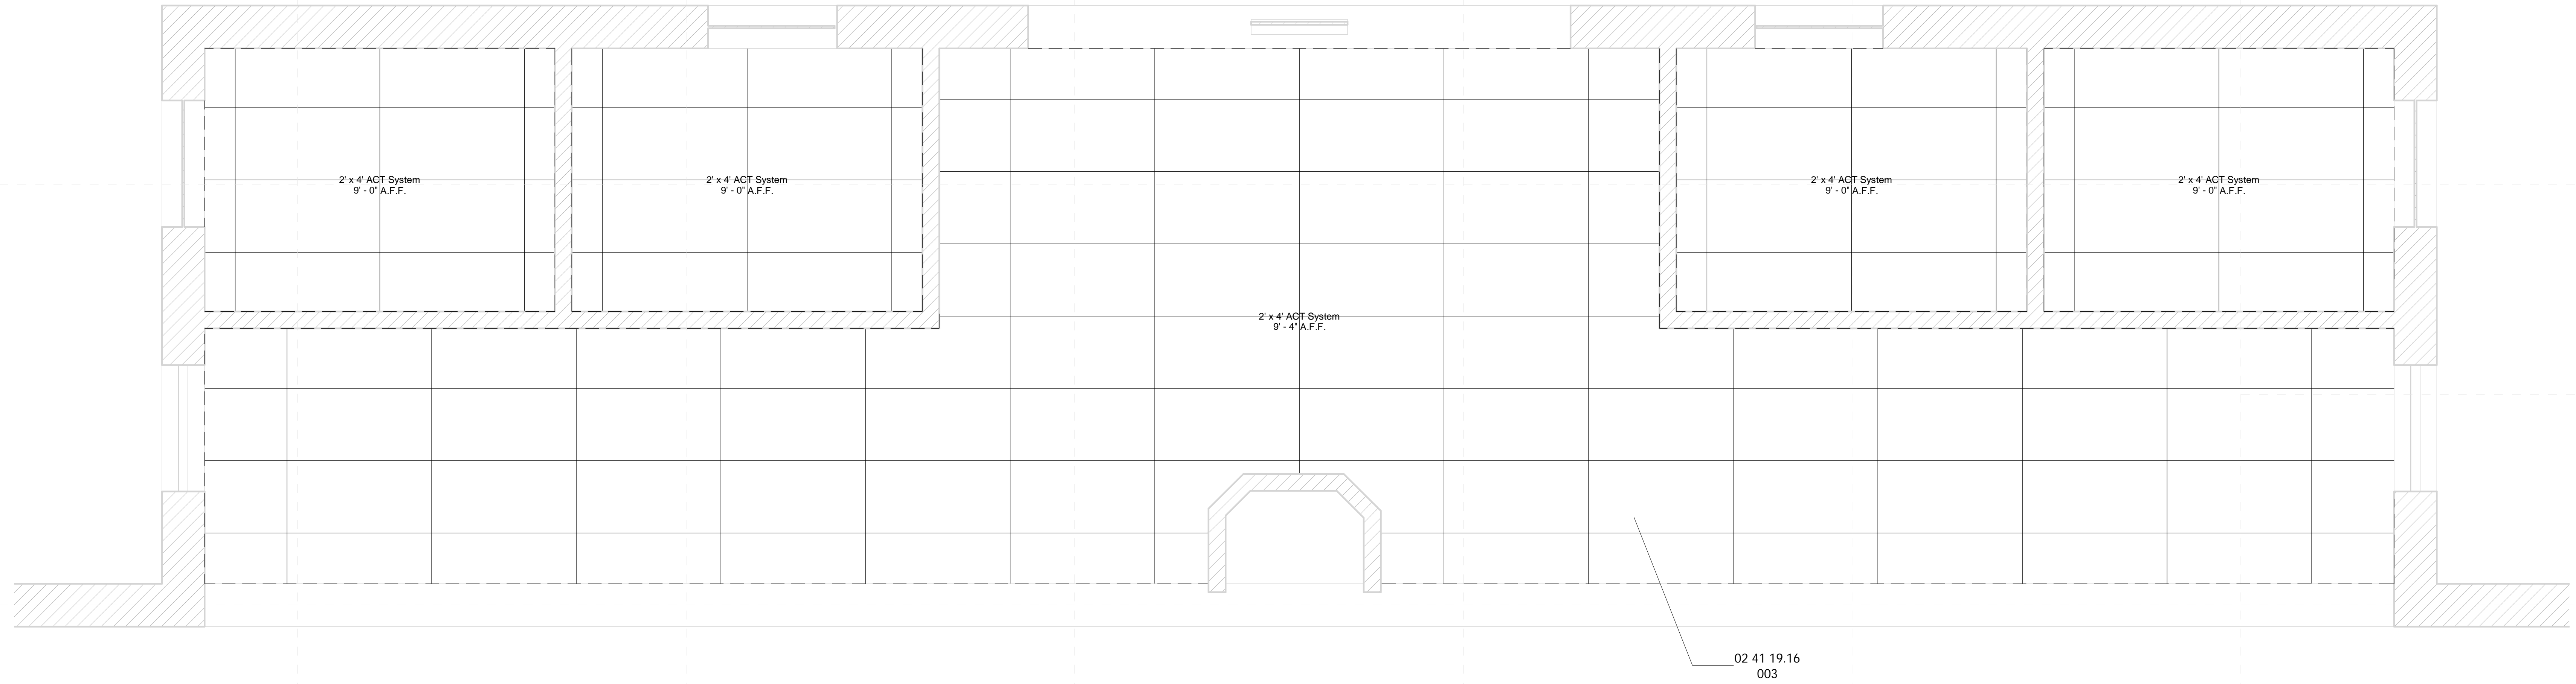

1 PCS Junior High School - Concessions - Existing
1/2" = 1'-0"

Specific Notes

02 41 19.16 003	Remove Ceiling & Grid
-----------------	-----------------------

**Not For
Construction**

PCS Junior High School Renovations
132 N Main St
Pontotoc, MS 38863

Schematic
Design

Project No 21064


Date

Revisions Rev Date

Revisions	Rev Date

A101

New Construction

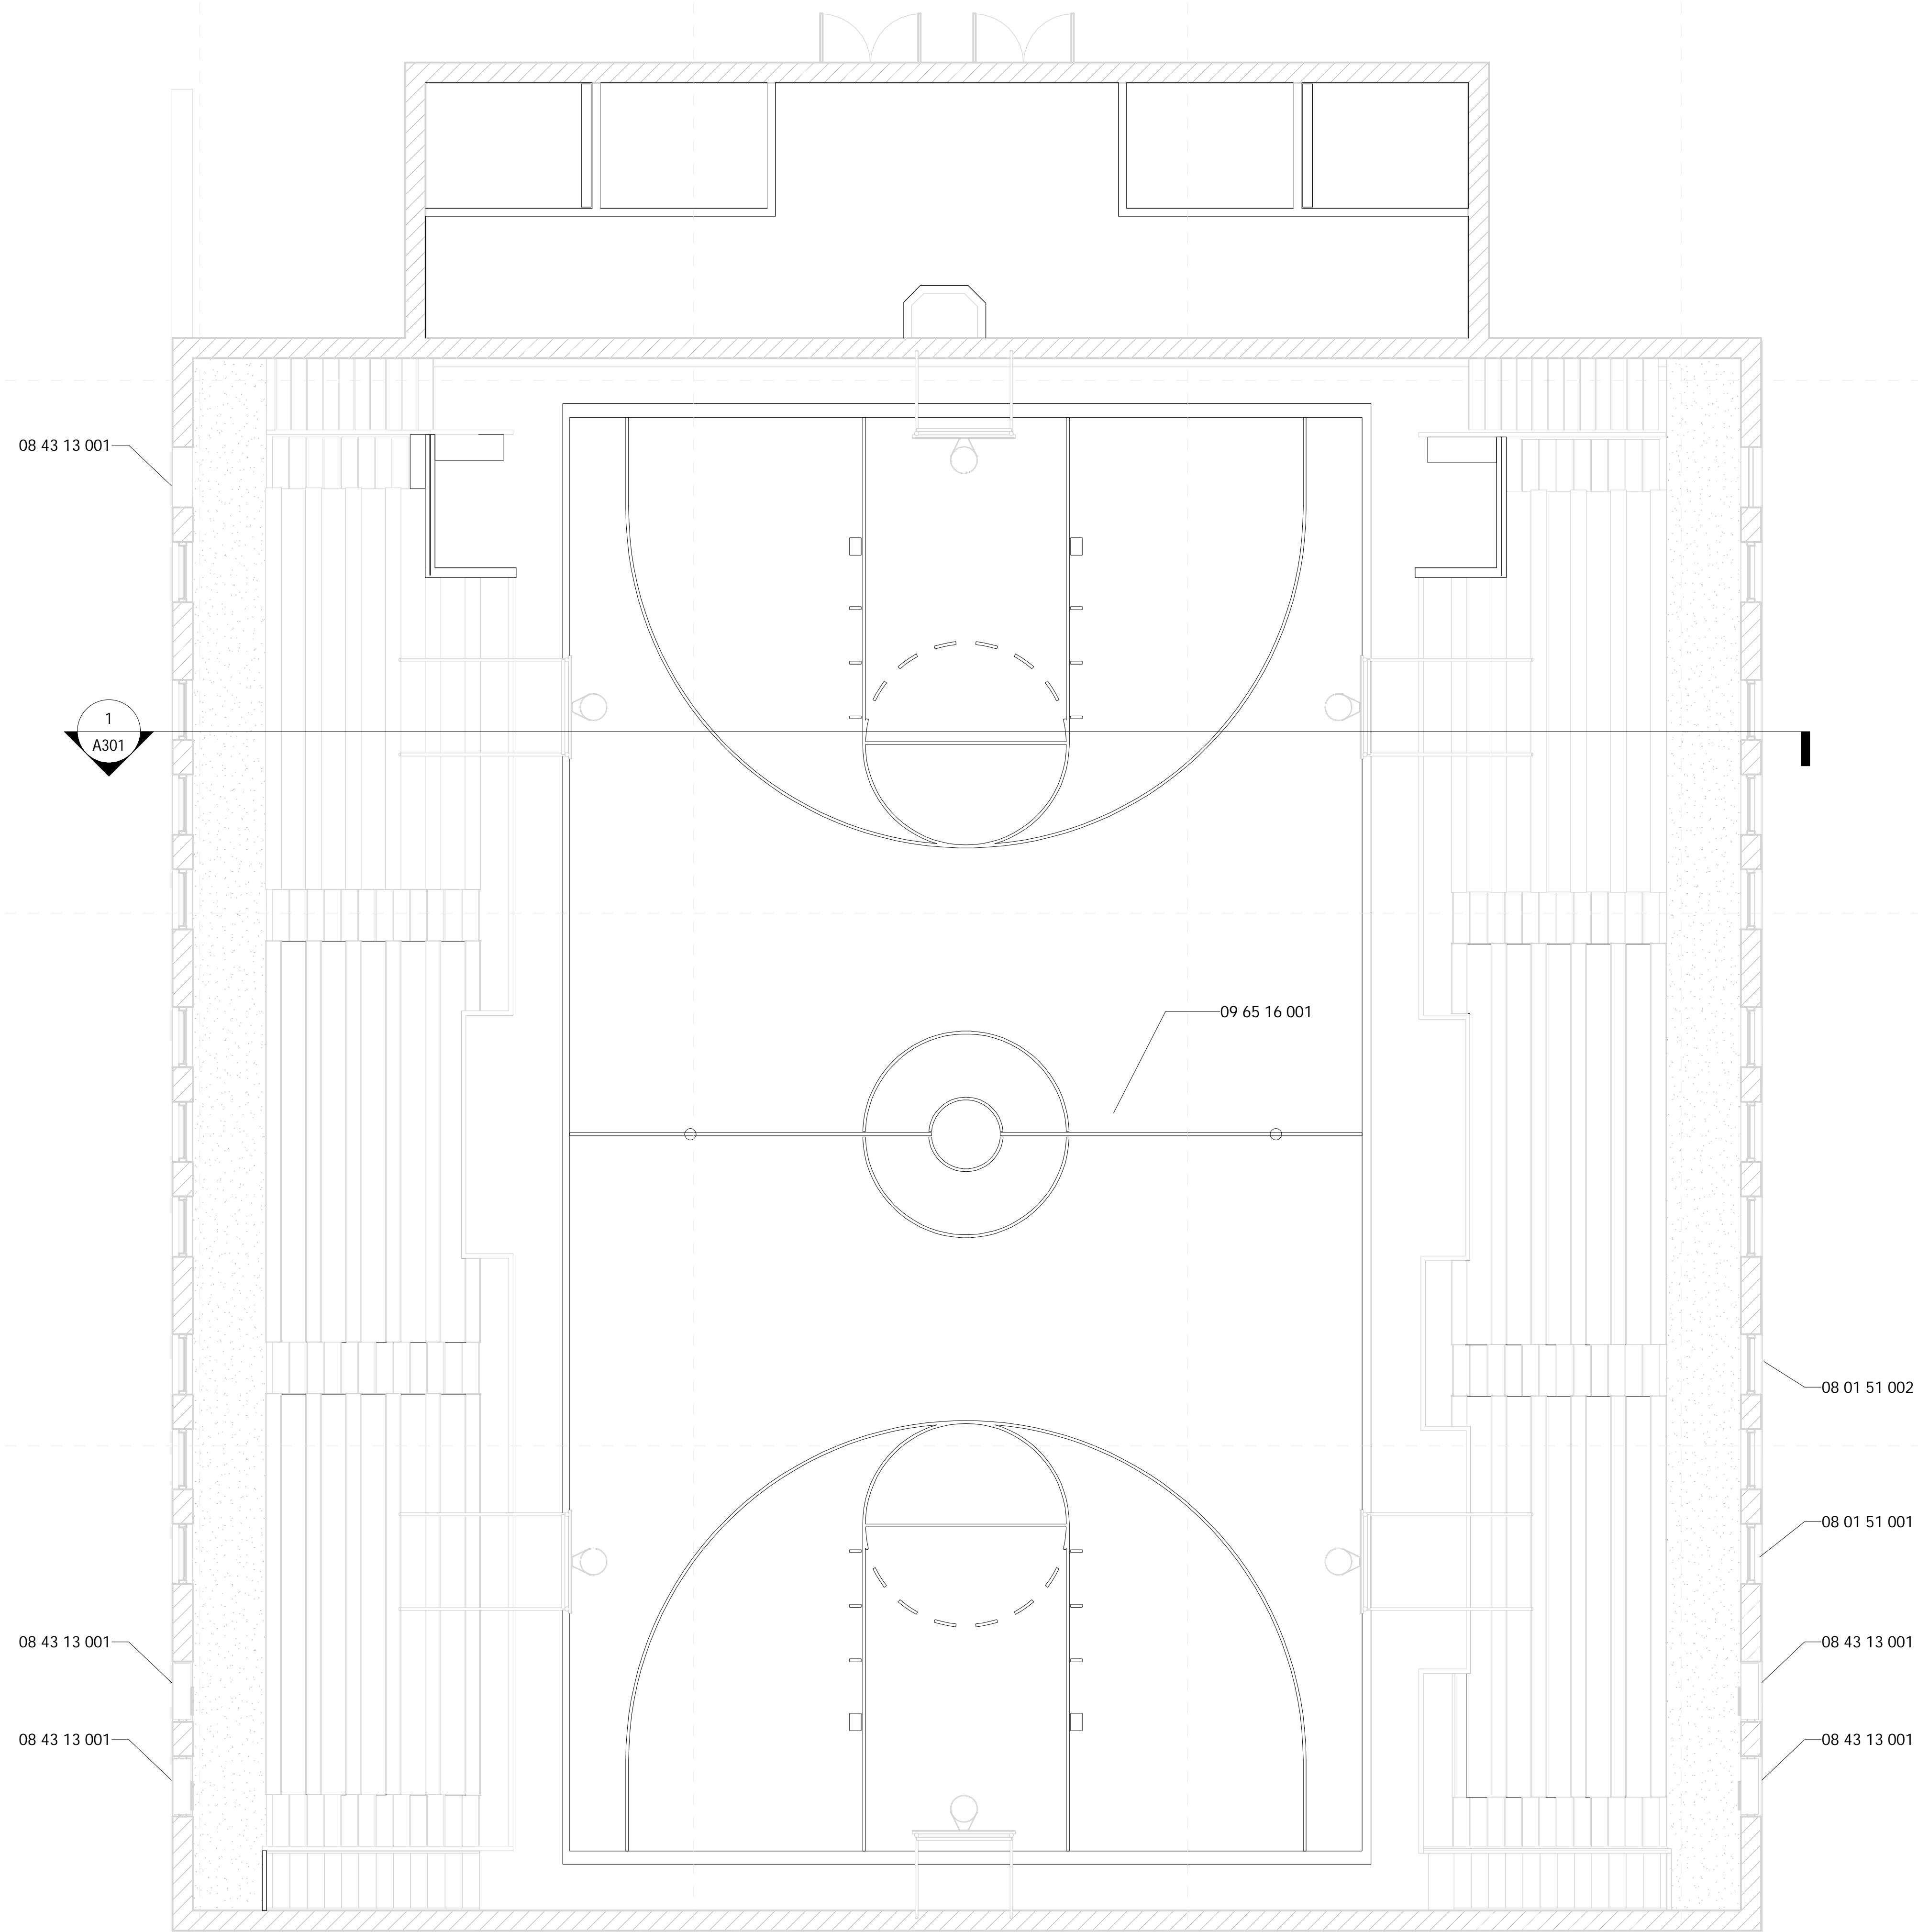

Specific Notes

08 01 51 001	Replace any damaged glass at existing windows in space
08 01 51 002	Clean frames and glass throughout space
08 43 13 001	Install New Storefront to Matching Existing Aluminum Window Mullion Pattern
09 65 16 001	Install new multi purpose rubber flooring with floor detailing for basketball & volleyball; install volley ball net inserts

1 PCS Junior High 2nd LVL - Gym - New Construction
3/16" = 1'-0"

Not For Construction

PCS Junior High School Renovations
132 N Main St
Pontotoc, MS 38863

Schematic Design

Project No 21064


Date

Revisions Rev Date

Revisions	Rev Date

A102

Concessions


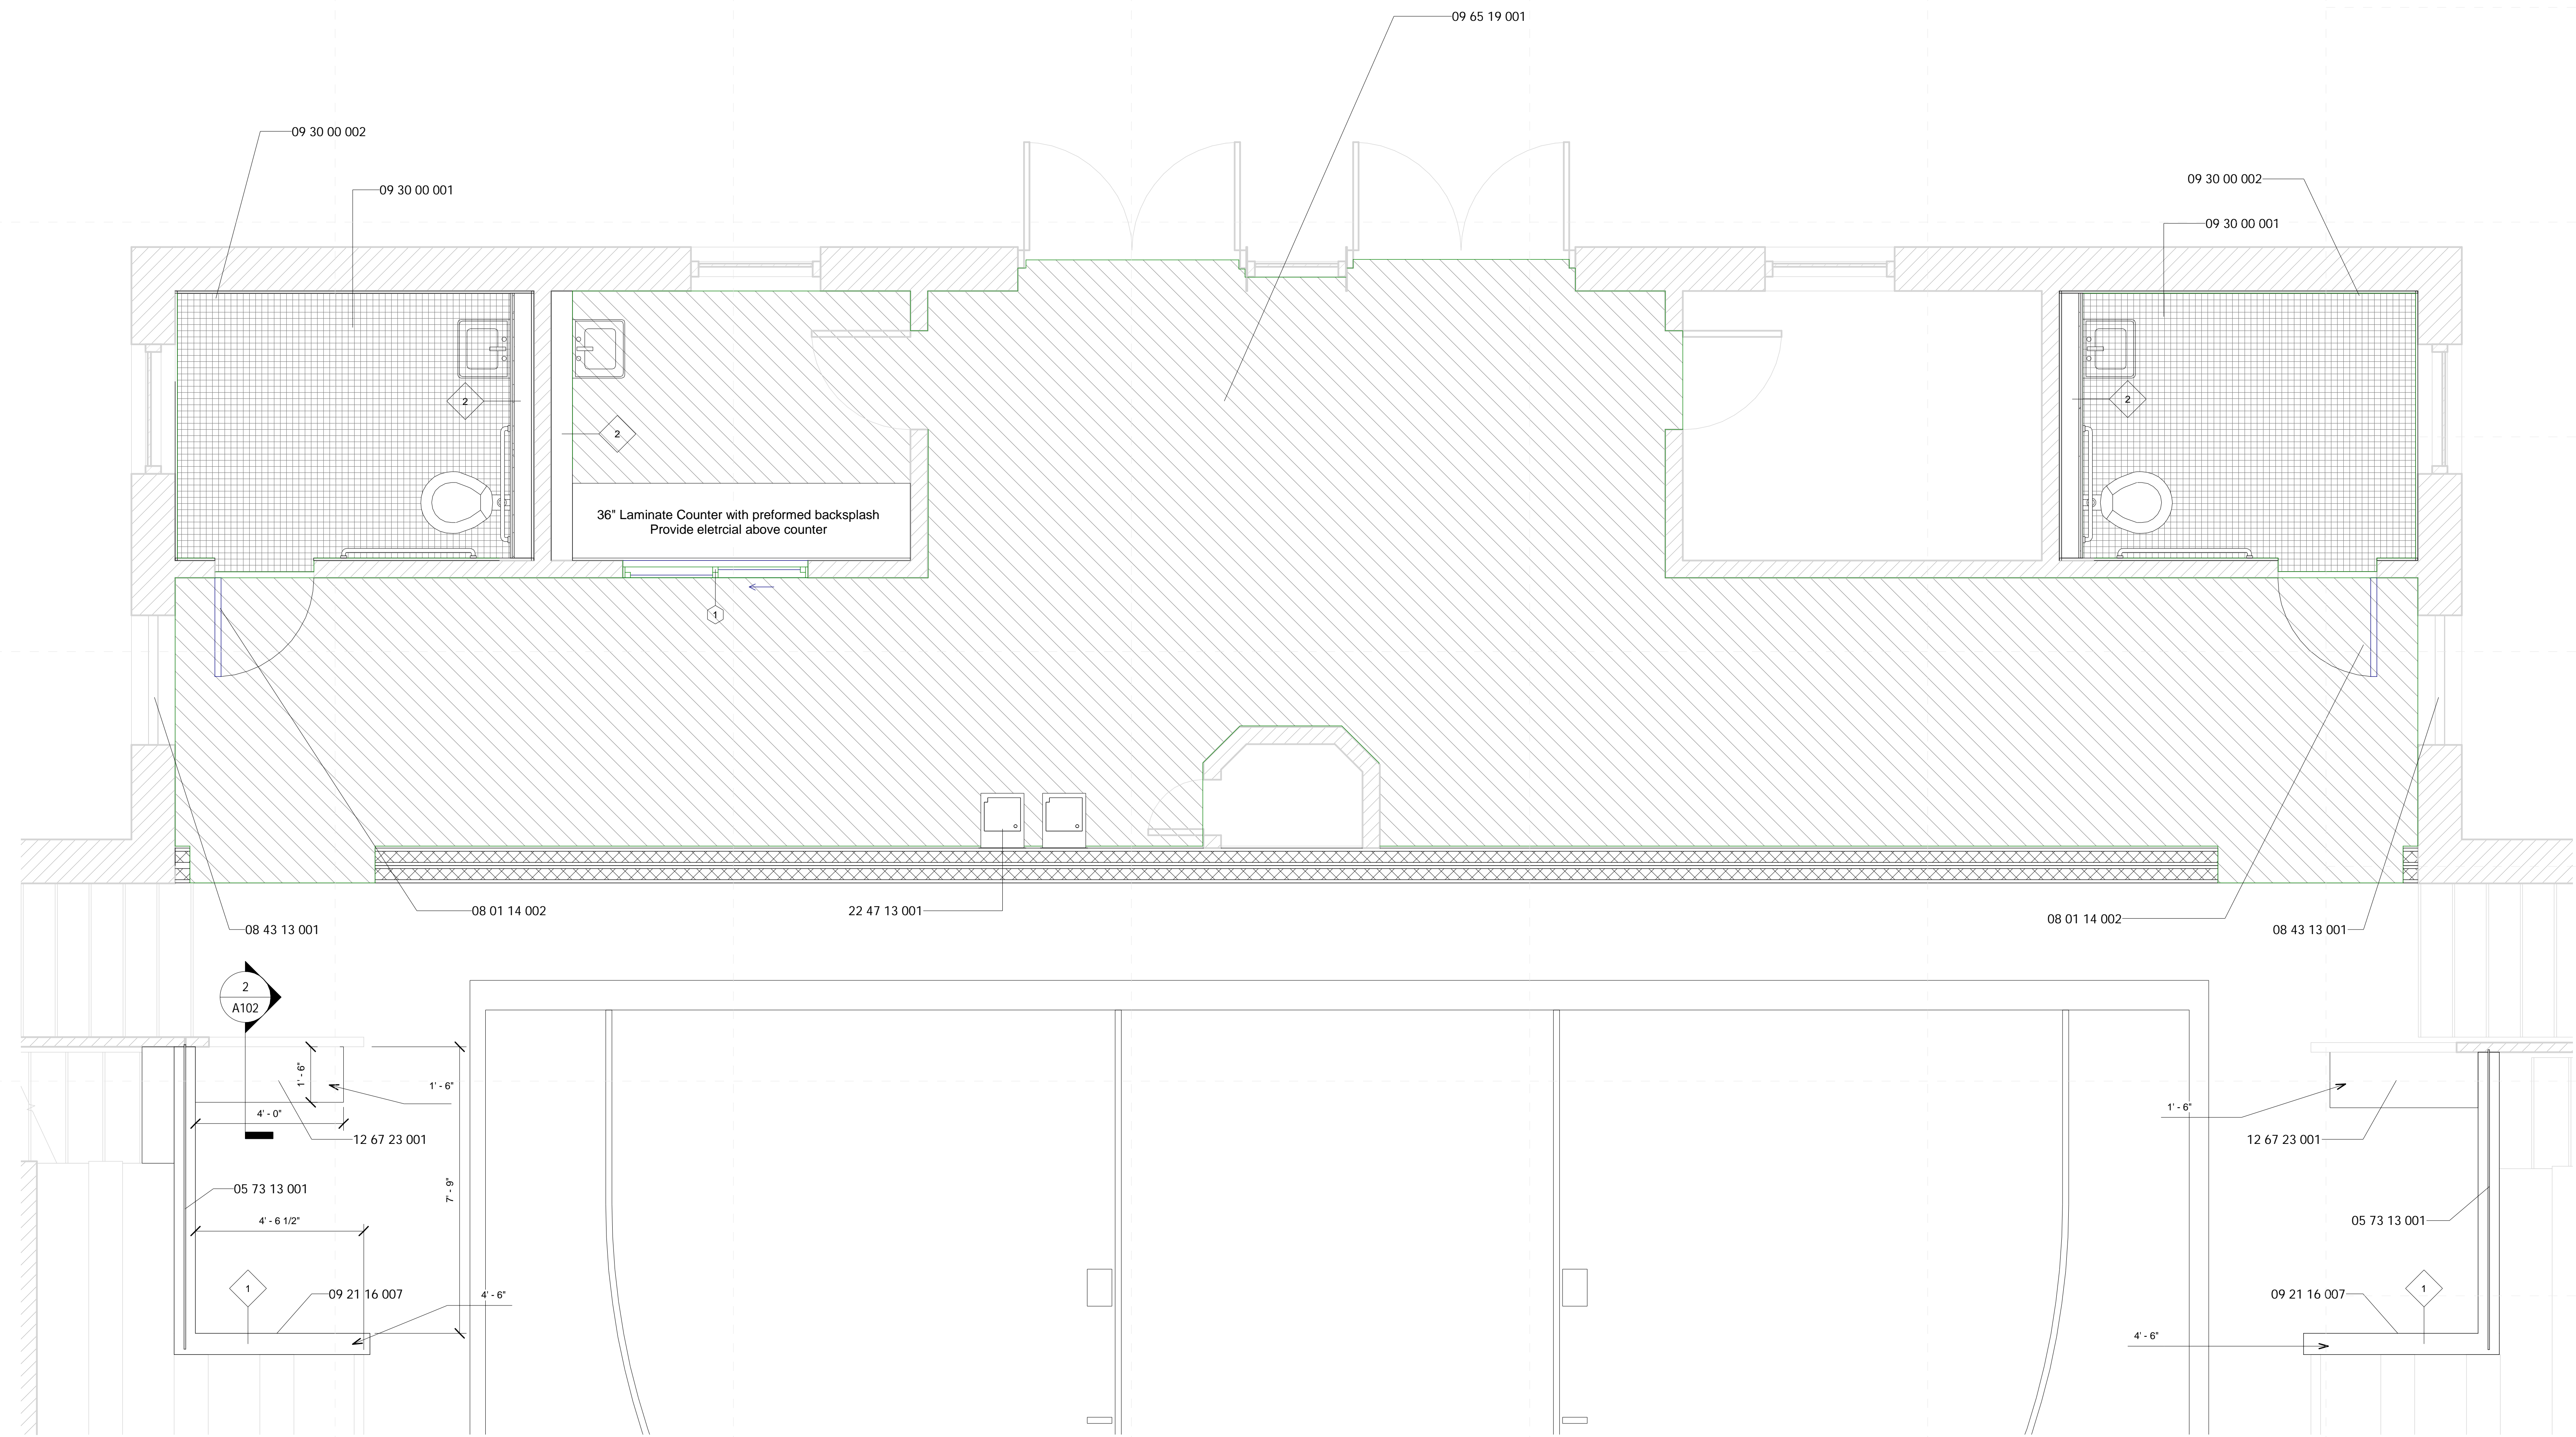


PCS Junior High School 2nd LVL - Concessions - New Construction

1
1/2" = 1'-0"


Specific Notes

05 73 13 001	Install Frameless 3/4" Tempered Glazing Rail 12" High with Eased Edges as Gaurdrail
08 01 14 002	Flip door/jamb assembly; replace hardware with new; make standard carpentry repairs to door panel as needed
08 43 13 001	Install New Storefront to Matching Existing Aluminum Window Mullion Pattern
09 21 16 007	New 6" Metal Stud wall, wrapped with 5/8" sheetrock & painted
09 30 00 001	New tile @ floor
09 30 00 002	New tile @ walls (full height)
09 65 19 001	Install new LVT flooring; coordinate material & pattern with Owner
12 67 23 001	New bench seat; glue up pine slab with no visible joints when painted; paint same as other bench tops
22 47 13 001	Install double fountain with bottle filler & ADA height for 1 fountain

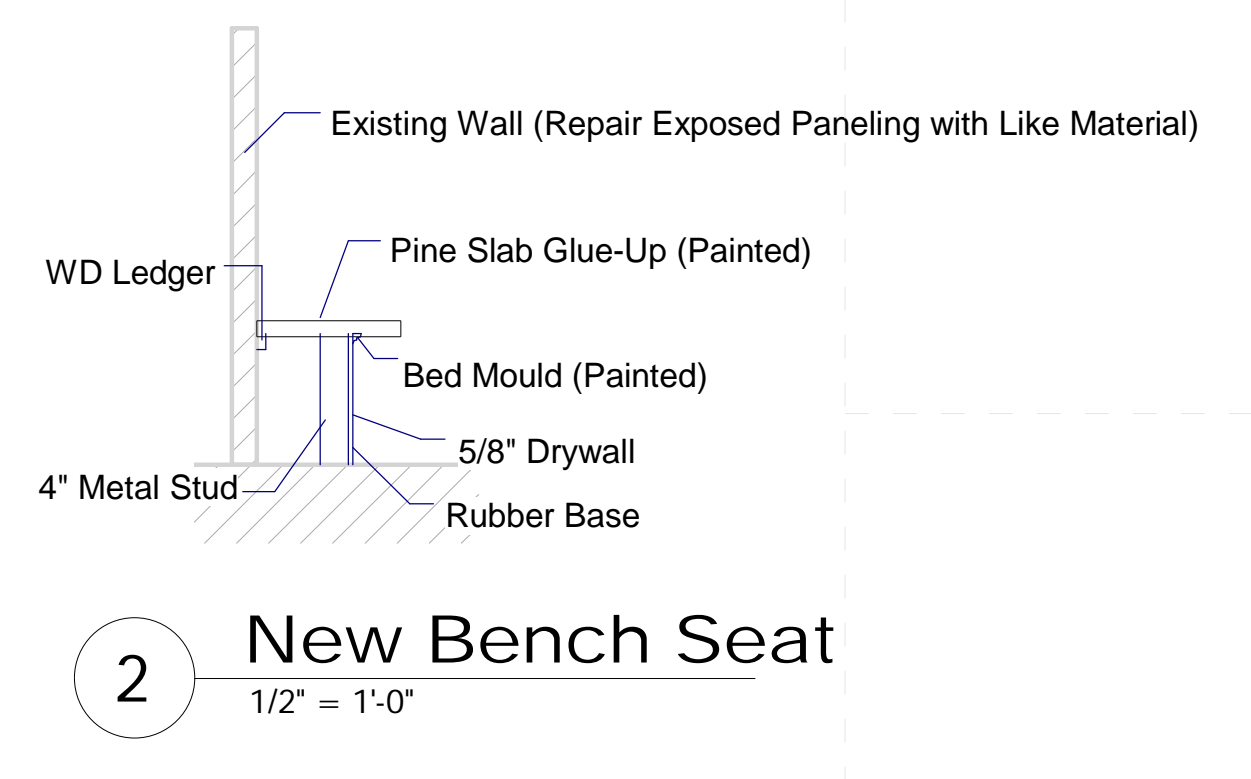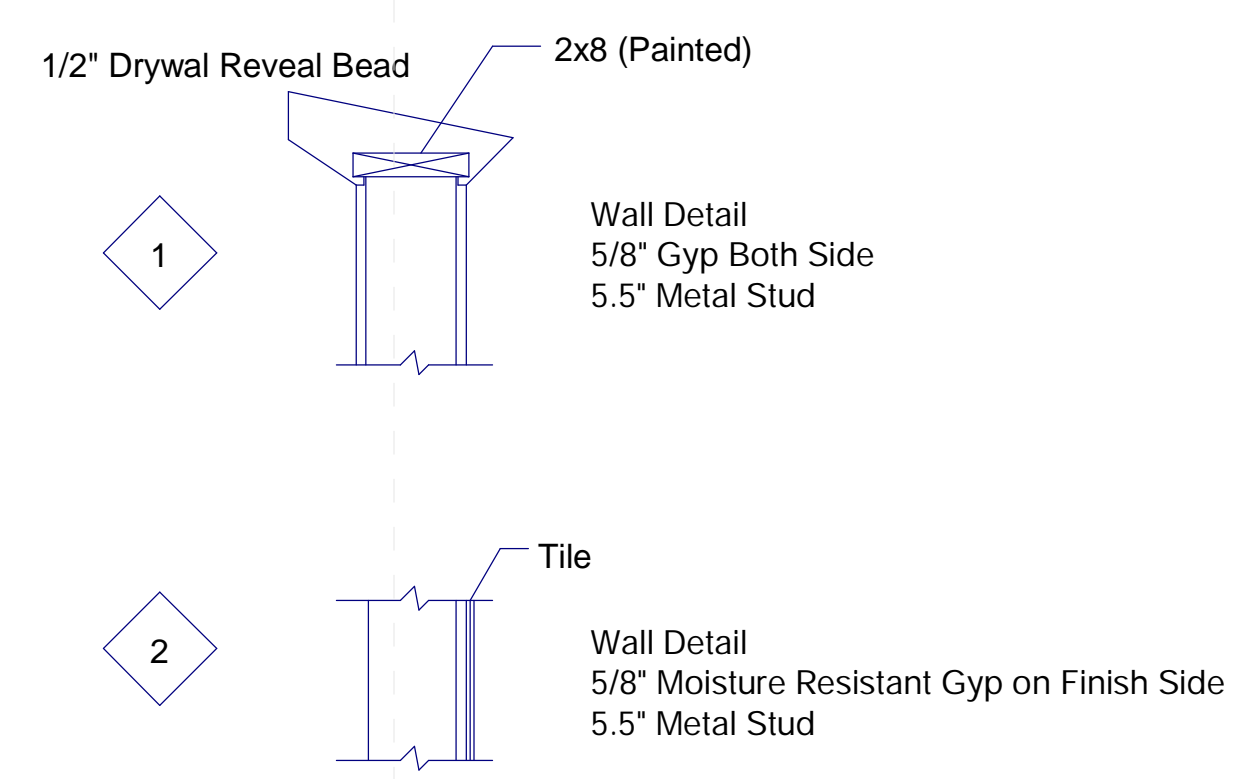

9/22/2021 10:17:19 AM D:\my stuff\BUSINESS\work\2019\dale\Partners\21064 - Pontotoc ESSR\models\PCS Junior High School.rvt

Not For
Construction

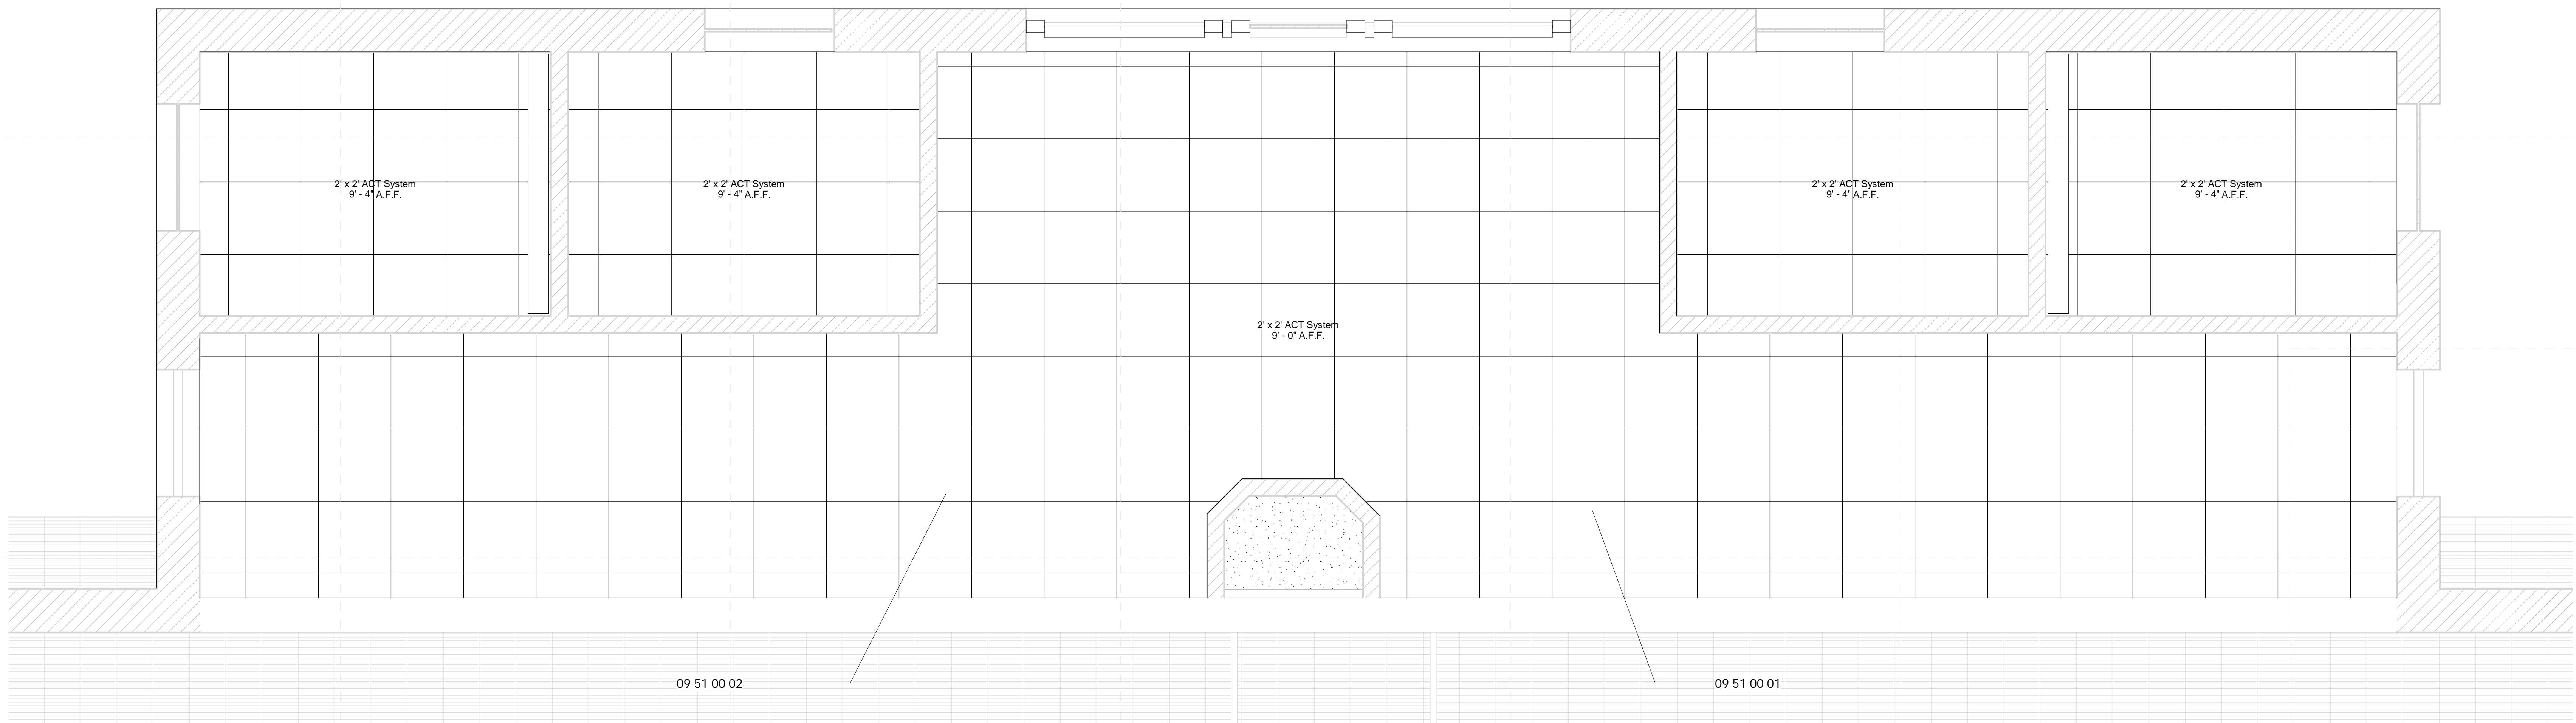

1 PCS Junior High School - Concessions - New Construction
1/2" = 1'-0"

Specific Notes

09 51 00 01	Install New 2x2 Lay In Ceiling
09 51 00 02	Contractor shall coordinate all Ceiling grills, fixtures, sprinklers, etc. and provide refinished or new for new installation

**Not For
Construction**

PCS Junior High School Renovations

132 N Main St
Pontotoc, MS 38863

Schematic
Design

Project No 21064


Date

Revisions Rev Date

Revisions	Rev Date

A301

Upper Gym

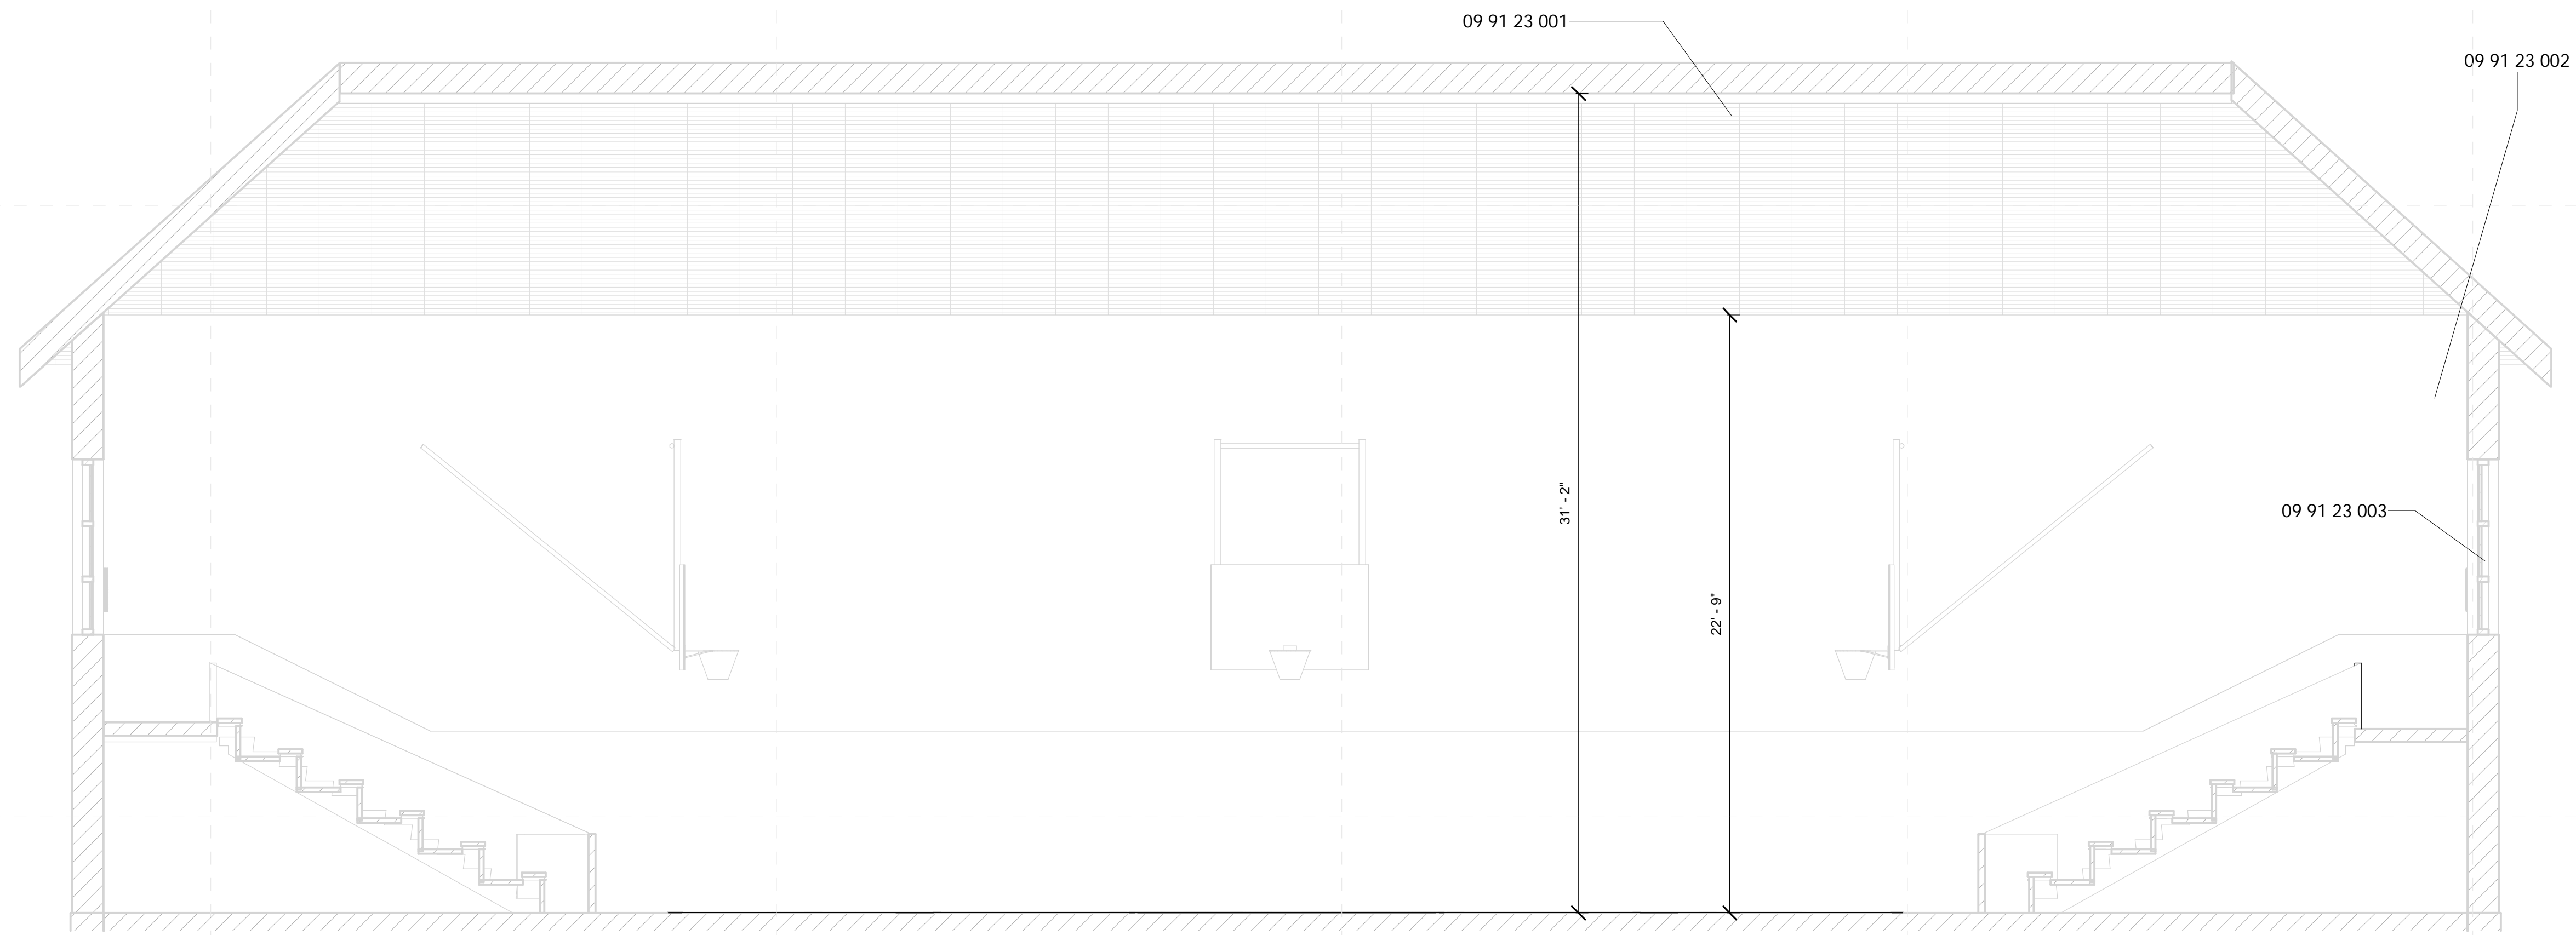

1 Gym Level Section
1/4" = 1'-0"

Specific Notes

09 91 23 001	Paint all structural members, surfaces, and underside of roof deck
09 91 23 002	Paint and patch all plaster as needed; patching shall be with like material
09 91 23 003	Paint all trim & jambs as well as any previously painted mullions/mutins throughout

Not For Construction

PCS Junior High School Renovations
132 N Main St
Pontotoc, MS 38863

Schematic Design


Project No 21064

Date

Revisions Rev Date

A401

Bleacher Seating

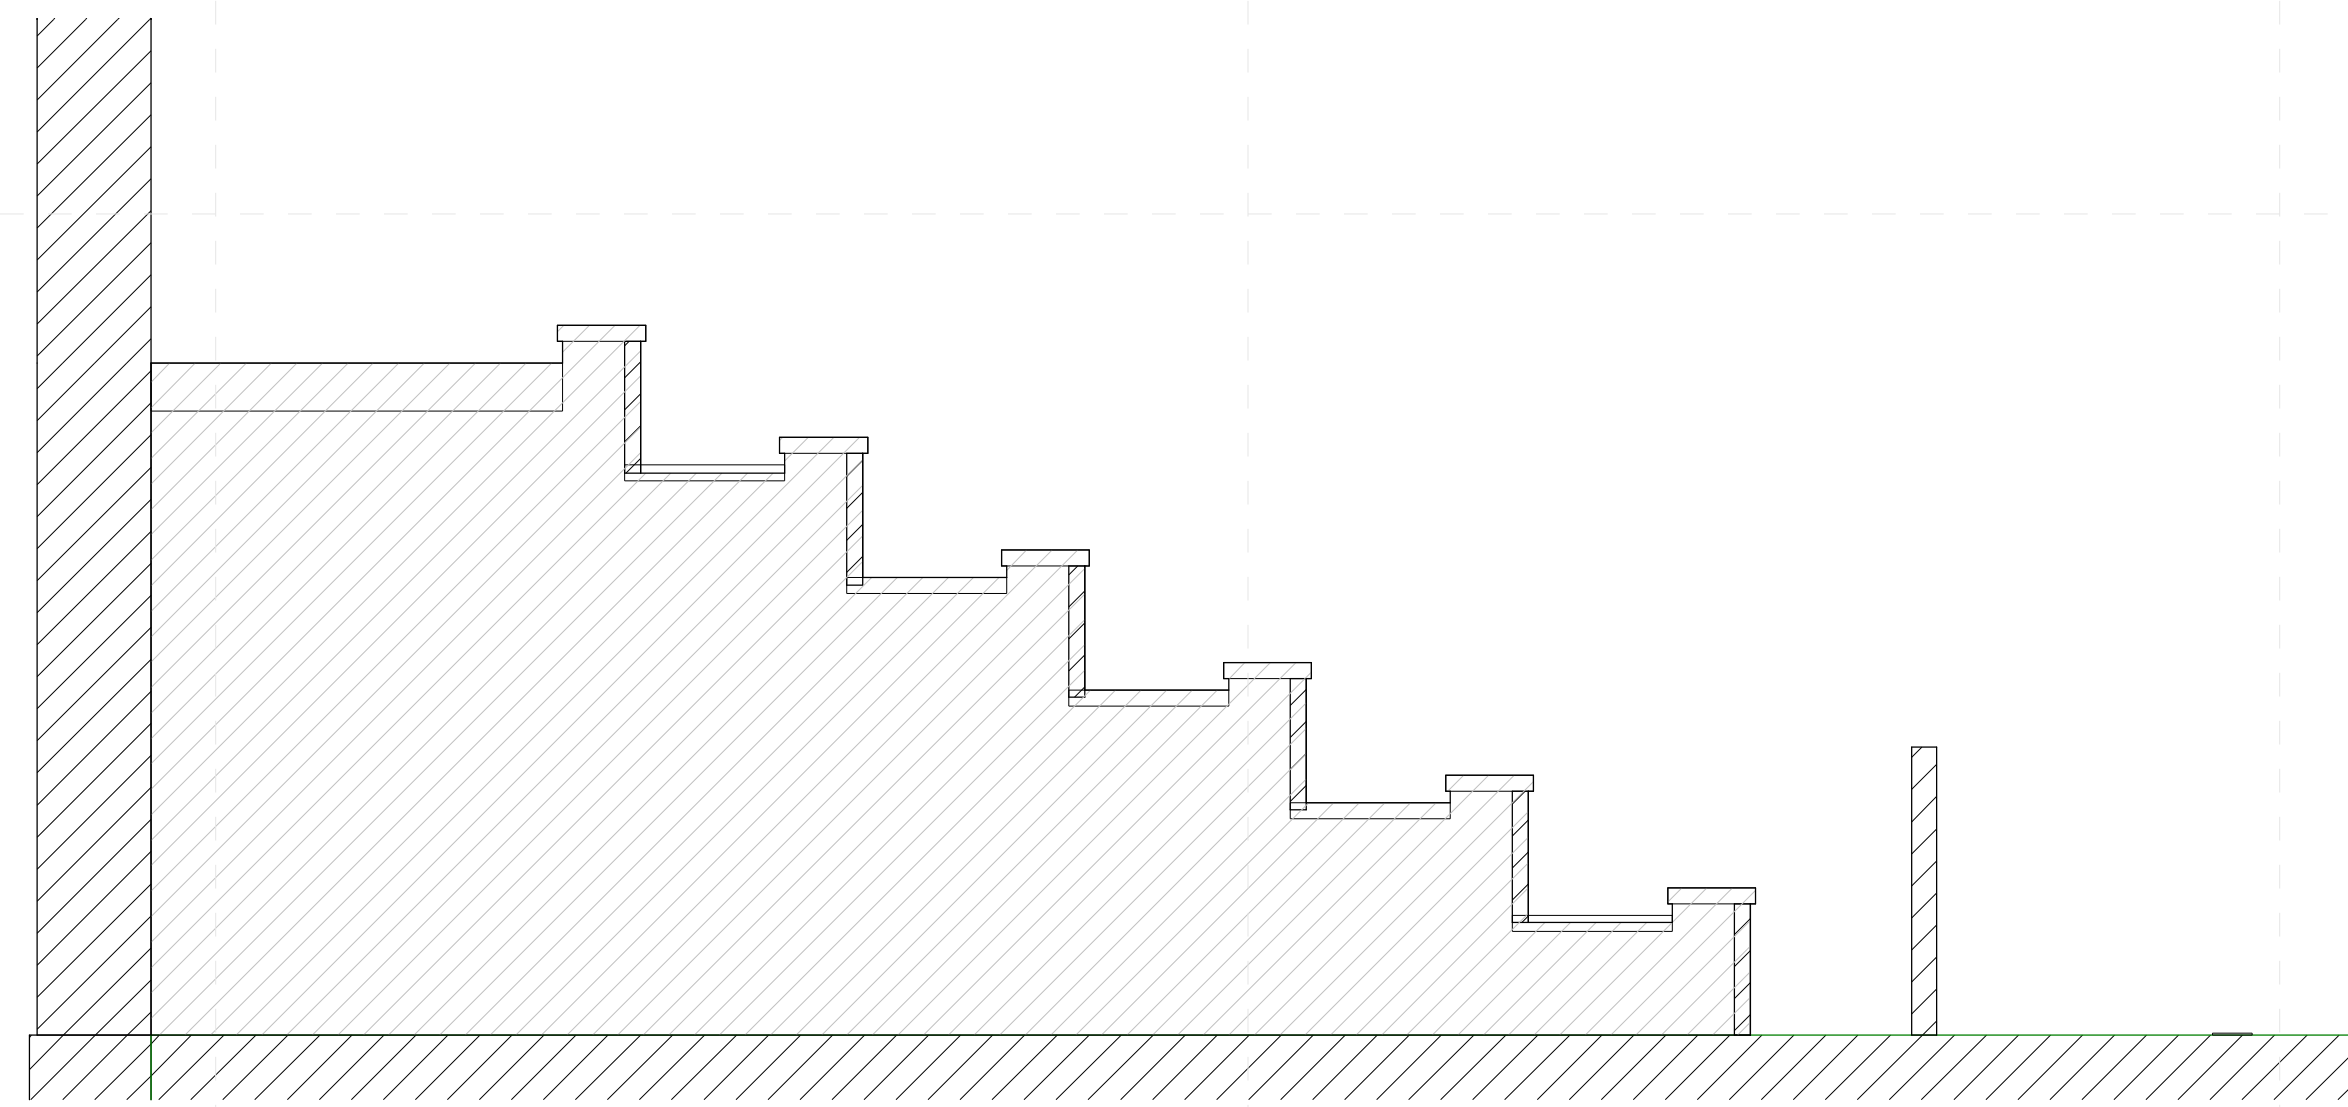

1 Existing Bleachers
1/2" = 1'-0"



EXAMPLE OF TYPICAL NEEDED REPAIR

- LIFT DAMAGED BOARD AT STEP FRONT AND RESECURE
- ADD MISSING TRIM TO UNDERSIDE OF FRONT BOARD AS IS TYPICAL; MATCH PROFILE OF SIMILAR

BLEACHER REPAIR NOTES

1. Repair any rot with new wood boards with matching profiles and density.
2. Any split wood shall be repaired with a standard carpentry glue repair only if and when the repaired wood appears as new after the repair is made.
3. All wood (painted or unpainted) shall be sanded with 120 Grit as preparation for new paint. It is not necessary to remove paint entirely as long as these requirements are met:
 - A. wood is smooth in appearance and to the touch
 - B. existing paint is not chipped or peeling
 - C. no evidence of past or present issues concerning the proper adhesion of previously painted surfaces exists
4. Existing roundovers and other profiles shall not be sanded so that they lose their detail.
5. Any new wood shall be primed and sanded for flush appearance and feel to it's neighboring members.
6. Any boards that are to be replaced within a field condition shall be spliced in so that joints in the field do not line up from one row to the next. Proximity of such joints shall not be closer than 1/3 the members typical length.
7. All woodwork that makes up the bleacher assembly, including but not limited to aisles, risers, treads, bench seats, flooring, partial height walls, etc. shall be primed, resanded with 150 grit sandpaper, and then coated with a minimum of 2 coats of an enamel paint.
8. Contractor shall provide a finished sample measuring no less than 10 square feet of woodwork for the architect's approval before repair is made to the rest of the bleacher project.

**Not For
Construction**

PCS Junior High School Renovations
132 N Main St
Pontotoc, MS 38863

Schematic
Design

Project No 21064


Date

Revisions Rev Date

Revisions	Rev Date

AD102

Demolition

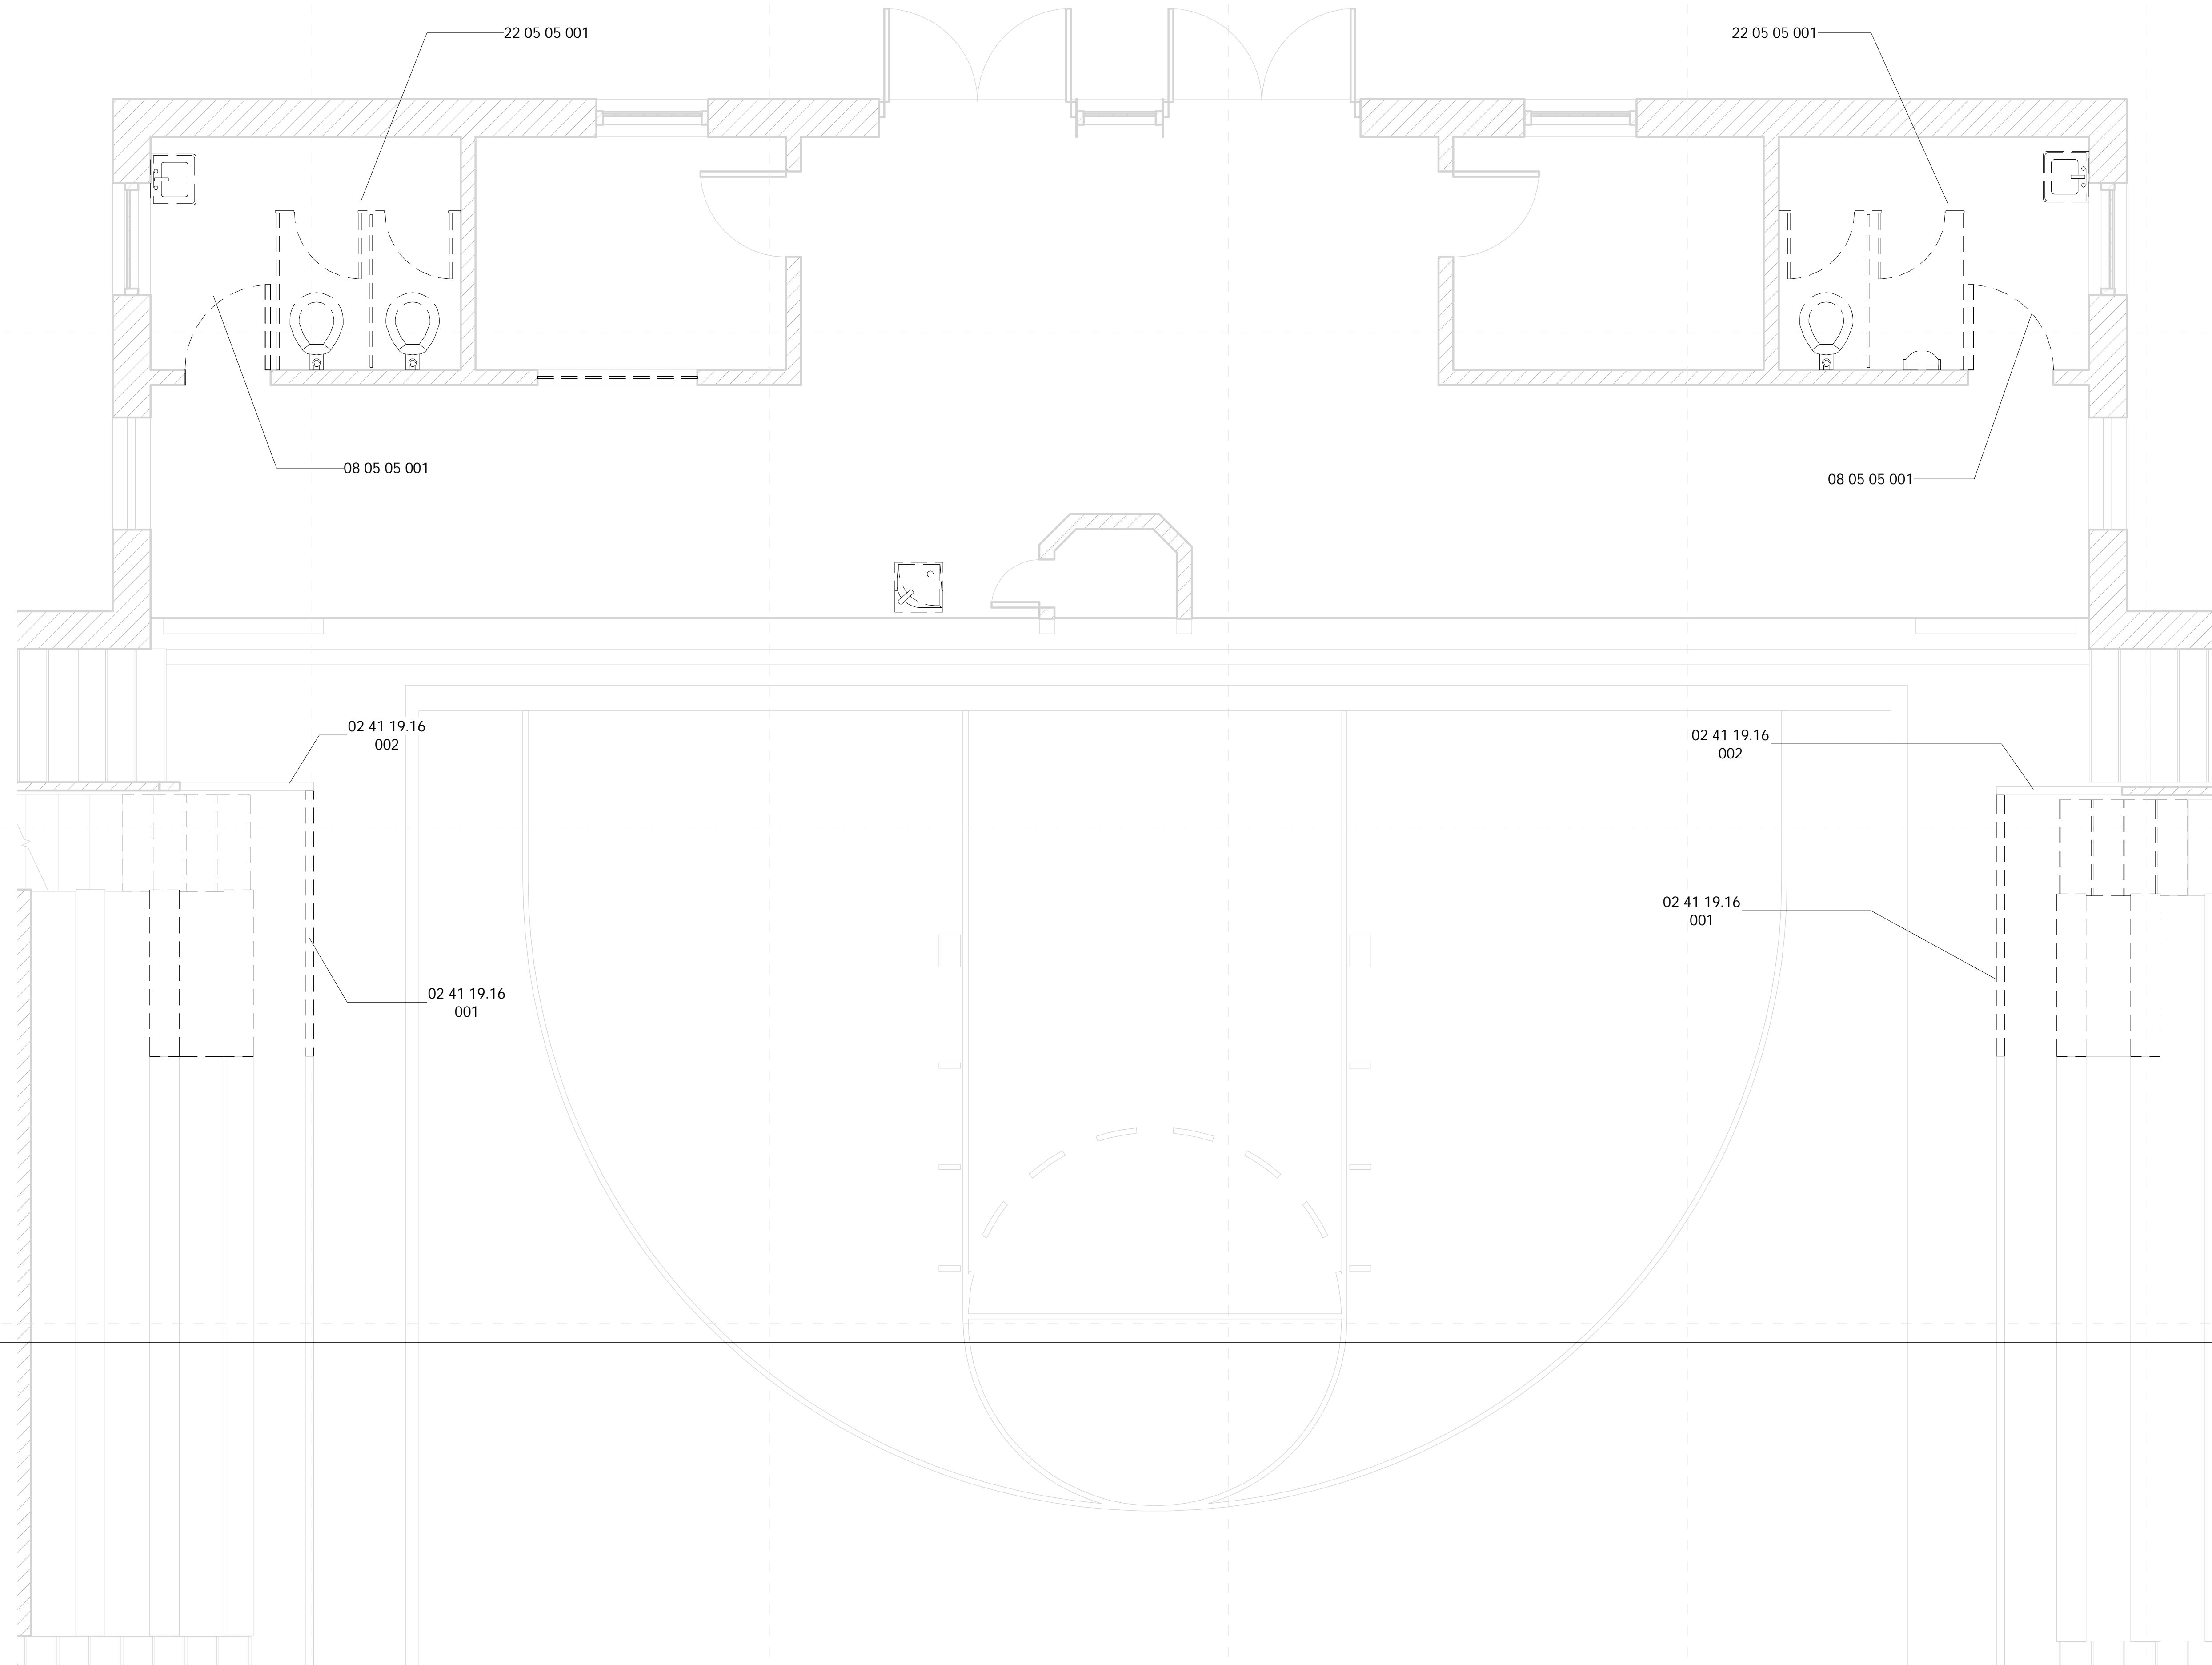

1 PCS Junior High School 2nd LVL - Concessions - Demo
3/8" = 1'-0"

Specific Notes

02 41 19.16 001	Remove Bleacher wall and seats as indicated; cut with straight flush cuts; support as need with like material
02 41 19.16 002	Preserve wall and corner post; take care to protect post from damage
08 05 05 001	Remove Door Panel, Jambs, & Trim in their entirety; keep undamaged for reuse
22 05 05 001	Remove Fixtures and Partitions

9/22/2021 10:17:22 AM D:\my stuff\BUSINESS\work\2019\dale\Partners\21064- Pontotoc ESSRL\models\PCS Junior High School.rvt